



T046 - Replacement of VAC3 & VAC4 Vacuum Pumps (M0358MS/M0359MS)


Jan 2021 (v2.0)

Conversion

The ISO pumps Vac3A and Vac4B are no longer available from Gascoigne Melotte. Replacements vacuum pump kits are available from Milking Solutions that use the same foot bolts and vertical ports, for easy replacement.

Vac3A is replaced by kit M0400MS (VP1500; 1100 Lt/min)

Vac4B is replaced by kit M0399MS (VP2200; 1800 Lt/min)

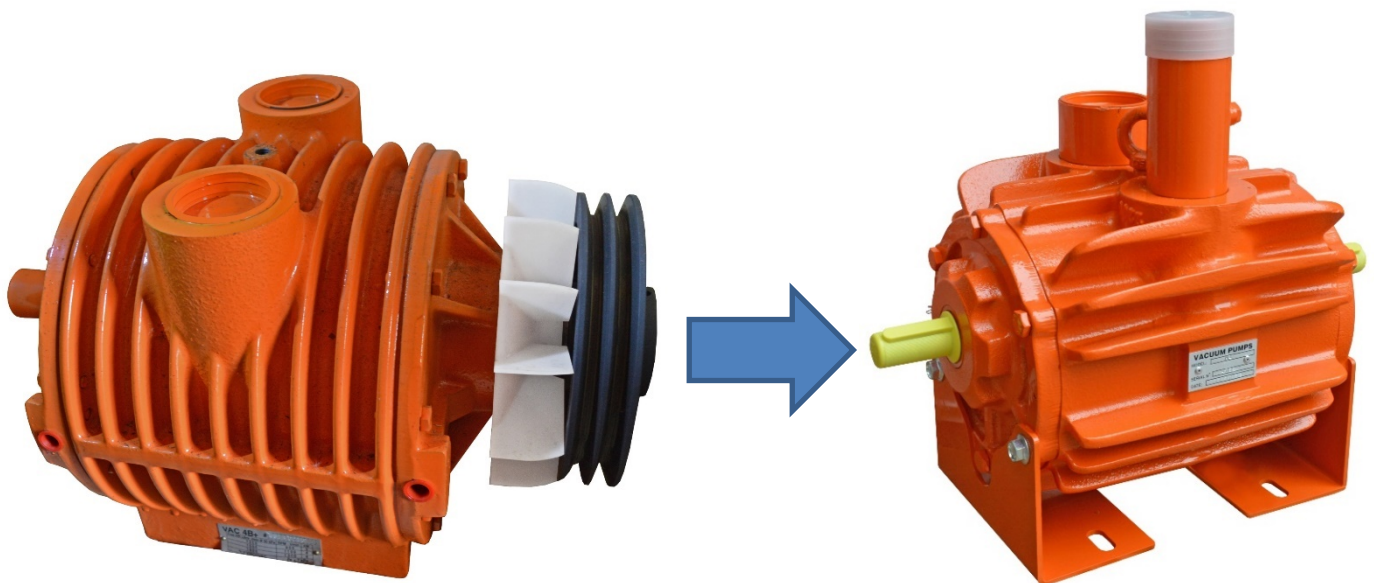

The following are included within the kits to replace existing parts;

M0400MS

Guard M0360MS

Pump Pulley 150x24x1

Motor Pulley 112x28x1

Belt 1x B44

Pump M0358MS

M0399MS


Guard M0360MS

Pump Pulley 150x24x2

Motor Pulley 115x28x2

Belts 2x B50

Pump M0359MS

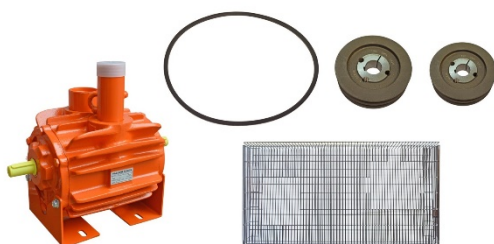

PUMP	Lt/ min	Pump RPM	Pump PCD	Pump Bore	Pump Grooves	kW	Pha se	Motor PCD	Motor Bore	Motor Grooves	Belt
Vac 3A	900	1060	180	28	2	2.2	1/3	132	28	2	A48/ A1250
Vac 3A	1100	1320	180	28	2	3	1/3	160	28	2	A50/ A1300
VP1500	1020	925	150	24	1	2.2 (4.8A)	1/3	100		1	B44
VP1500	1100	1050	150	24	1	2.2 (4.8A)	1/3	112		1	B44
VP1500	1250	1175	150	24	1	3 (5.8A)	1/3	125		1	B44
VP1500	1500	1350	150	24	1	4 (7.4A)	3	140	28	1	B44
Vac 4B	1250	900	180	28	2	3	1/3	112	28	2	A51/ A1330
Vac 4B	1550	1100	180	28	2	4	3	132	28	2	A52/ A1360
Vac 4B	1800	1300	180	28	2	4	3	160	28	2	A52/ A1360
VP2200	1800	1100	150	24	2	4 (8.9A)	3	115	28	2	B50
VP2200	1880	1150	150	24	2	4 (8.9A)	3	120	28	2	B50
VP2200	2070	1225	150	24	2	4 (8.9A)	3	125	28	2	B50
VP2200	2300	1325	150	24	2	5.5 (10.9A)	3	140	38	2	B50